

Manual N° 6455

09/24

INSTALLATION/CONNECTION

Magnetic loop

with the PIC 4410, OP'DRIVE 3.0 or CS 300/320 boxes

Installation


The loop must be installed under the surface of the pavement, where the signal must be detected.


The cable used must be at least 1,5 mm² thick.

Opt for a cable with screen (connected to ground on the detector side), if the loop output is in contact with other cables in the same sleeve or if it is very long (max. 75 m).

In addition, the output should be twisted by at least 25 turns per meter.

The loop will be laid out as follows:



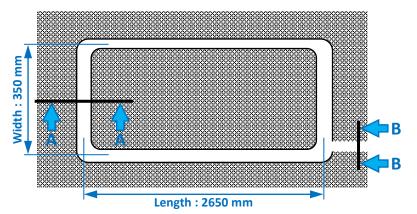

Loop perimeter = **6000 mm** Connecting cable = **9000 mm**

Installation of a loop on site:

Create a rectangular channel that is the same thickness as the concrete disc (12 to 15 mm) with a depth of 40 to 50 mm, in accordance with the size of the closen loop.

Also create a channel for the connection between the loop and the detector (cabinet).

(Document reserved for installers)



Connection

Connect the magnetic loop

Terminals 7 and 8



Terminals 2 and 10: 24V ac/dc power supply

to terminals 15 and 16 of the PIC 4410 box

or

to terminals 14 and 15 of the OP'DRIVE 3.0 box

or

to terminals 1 and 2 (terminal strips x4) of the CS 300/320 box

Terminals 1 and 3:

to terminals 3 and 4 of the PIC 4410 box

0

to terminals 22 and 23 of the OP'DRIVE 3.0 box

or

to terminals 7 and 8 (terminal strips x3) of the CS 300/320 box (keep the bridges between 1-2 and 3-4)

